
EASTERN

2022 Annual Water Quality Reports



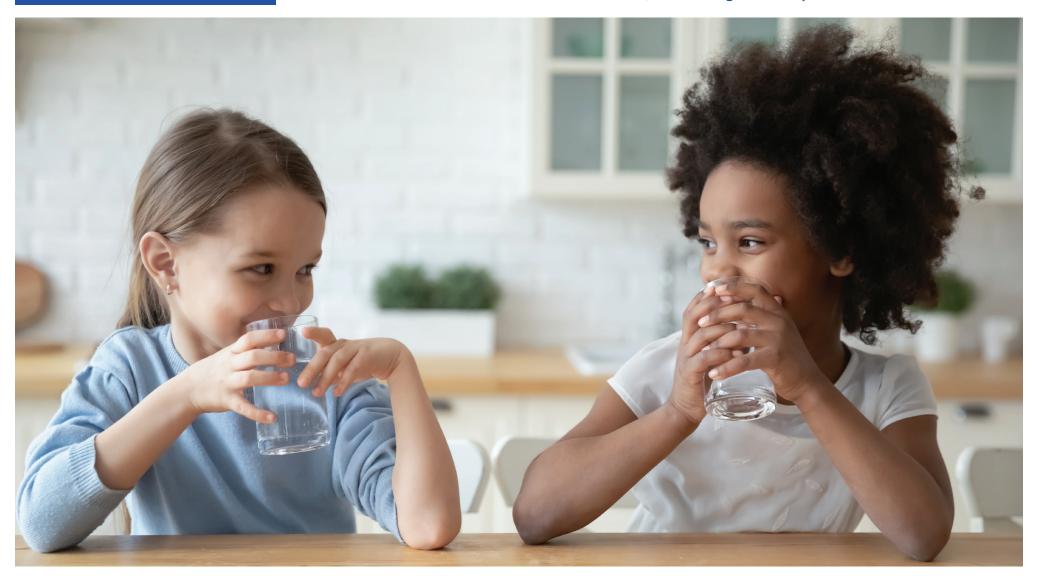

WHAT WE DO TODAY SHAPES TOMORROW'S FUTURE

Toho Water Authority is pleased to present its 2022 Annual Drinking Water Report, designed to inform you about the quality of the water we deliver every day. The report includes test results from water quality analyses conducted throughout 2022.





Toho Water Authority is pleased to present its annual drinking water report. The name of the report reflects the year the data was collected rather than the year published. This report is designed to inform you about the quality of the water we deliver every day. It is our pleasure to report that the drinking water we produce follows all federal and state water quality regulations. The water quality information in this report is organized by service areas and identified by the associated Public Water System (PWS) number. Use the map to determine your service area, then go to the associated water quality data. To request a printed copy of this report, please contact our Customer Service team at 407-944-5000.








TOHO'S PROMISE

Our Customers, Our Community, Our Employees **Trust That Toho Cares**

As an integral part of the community, Toho is dedicated to delivering exceptional services. Whether it's through in-person interactions, phone conversations, or our website, one thing remains certain—we care.

Toho is guided by a seven-member board of supervisors who oversee all operational policies and carefully manage the organization's budget. If you're interested in learning more about Toho, we encourage you to attend our regularly scheduled Board meetings. These meetings are open to the public and take place on the second Wednesday of every month at 5 p.m. in the Boardroom located at 951 Martin Luther King Blvd., Kissimmee, Florida 34741. To access the meeting agenda, please visit tohowater.com.

In compliance with Section 286.26 of the Florida Statutes, we prioritize inclusivity. If you require assistance to participate in any of these proceedings, please reach out to the office of the Executive Director beforehand. You can contact us at 407-944-5130 or via email at tohoattend@tohowater.com.

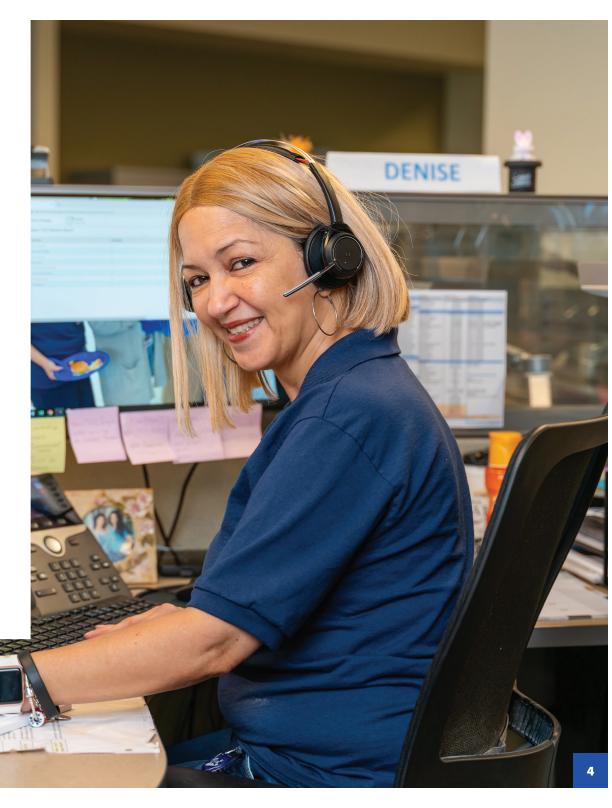

WATER SOURCE


Underneath Osceola County lies one of the largest pristine reservoirs of fresh groundwater in the country, the Floridan Aquifer. Water from this aguifer is of consistently high quality and is used as the source of potable water for Toho's water system. The aguifer is recharged by rainfall on the Lake Wales Ridge (US 27) in Osceola, Polk and Lake counties that is filtered through hundreds of feet of sand and rock in a natural cleansing process. Because of its high quality, the water we use needs little or no treatment other than aeration to remove hydrogen sulfide (odor) and disinfection. rive 4 free-flowing pump 7 sinkhole water table artesian well pump or sands surface pump surficial well recharge area lake surficial aquifer system limestone spring intermediate upper semiconfining unit aquifer system intermediate discharge area aquifer system freshwater salt water Floridan Cledit: chniwater.com

WATER QUALITY

Toho Water Authority (Toho) delivers to you water that is constantly tested for compliance with federal and state standards and regulations. During the period of January 1st to December 31st 2022, covered by this Consumer Confidence Report, highly trained scientists and technicians performed analyses on samples taken throughout your water system. The results of these analyses showed that the substances for which Toho is required to test, most were found to be at levels in the water substantially lower than the minimum acceptable levels. This brochure is a summary of the water quality provided to our customers. It is a record reflecting the hard work of our employees to bring you high quality water.





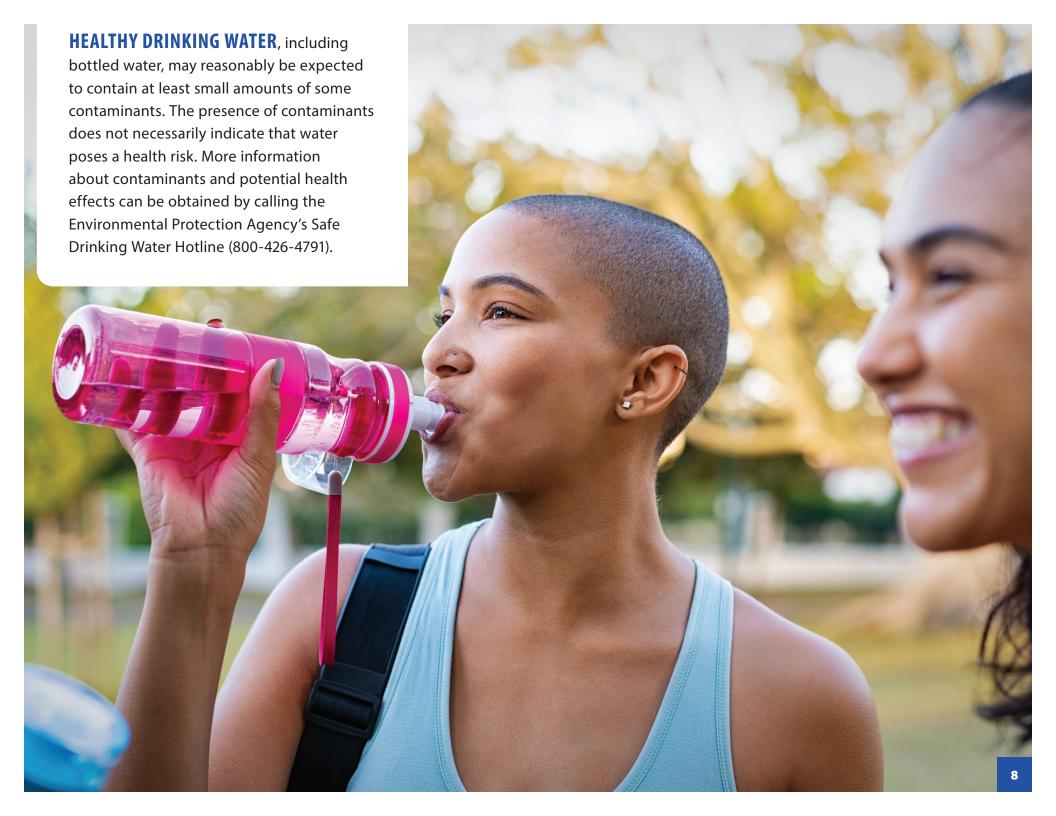





REQUIRED ADDITIONAL HEALTH INFORMATION

If present, elevated levels of lead can cause serious health problems, especially for pregnant women and young children. Lead in drinking water is primarily from materials and components associated with service lines and home plumbing.

Toho is responsible for providing high quality drinking water, but cannot control the variety of materials used in plumbing components.


When your water has been sitting for several hours, you can minimize the potential for lead exposure by flushing your tap for 30 seconds to 2 minutes before using water for drinking or cooking. If you are concerned about lead in your water, you may wish to have your water tested. Information on lead in drinking water, testing methods, and steps you can take to minimize exposure is available from the Safe Drinking Water Hotline or at www.epa.gov/safewater/lead.

The sources of drinking water (both tap water and bottled water) include rivers, lakes, streams, ponds, reservoirs, springs, and wells. As water travels over the surface of the land or through the ground, it dissolves naturally-occurring minerals and in some cases radioactive material, and can pick up substances resulting from the presence of animals or from human activity.

CONTAMINANTS THAT MAY BE PRESENT IN SOURCE WATER INCLUDE:

- Microbial contaminants, such as viruses and bacteria, which may come from sewage treatment plants, septic systems, agricultural livestock operations, and wildlife.
- Inorganic contaminants, such as salts and metals, which can be naturally-occurring or result from urban stormwater runoff, industrial or domestic wastewater discharges, oil and gas production, mining, or farming.
- Pesticides and herbicides, which may come from a variety of sources such as agriculture, stormwater runoff, and residential uses.
- Organic chemical contaminants, including synthetic and volatile organics, which are by-products of industrial processes and petroleum production, and can also come from gas stations, urban stormwater runoff and septic systems.
- Radioactive contaminants, which can be naturallyoccurring or be the result of oil and gas production and mining activities.

In order to ensure that tap water is safe to drink, EPA prescribes regulations which limit the amount of certain contaminants in water provided by public water systems. FDA regulations establish limits for contaminants in bottled water which must provide the same protection for public health.

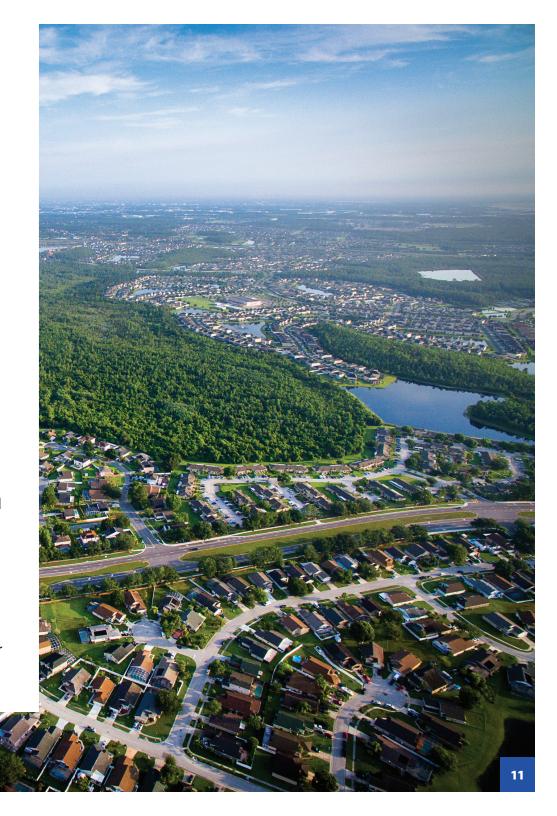

GLOSSARY AND ABBREVIATIONS

MAXIMUM CONTAMINANT LEVEL (MCL): The highest level of a contaminant that is allowed in drinking water. MCLs are set as close to the MCLGs as feasible using the best available treatment technology. MCLs are set at very stringent levels. To understand the possible health effects described for many regulated constituents, a person would have to drink 2 liters of water every day at the MCL level for a lifetime to have a one-in-a-million chance of having the described health effect.

MAXIMUM CONTAMINANT LEVEL GOAL (MCLG): The level of a contaminant in drinking water below which there is no known or expected risk to health. MCLGs allow for a margin of safety.

MAXIMUM RESIDUAL DISINFECTANT LEVEL (MRDL): The highest level of a disinfectant allowed in drinking water. There is convincing evidence that addition of a disinfectant is necessary for control of microbial contaminants.

MAXIMUM RESIDUAL DISINFECTANT LEVEL GOAL (MRDLG): The level of a drinking water disinfectant below which there is no known or expected risk to health. MRDLGs to not reflect the benefits of the use of disinfectants to control microbial contaminants.

RUNNING ANNUAL AVERAGE (RAA): The average of the monitoring period average for a year.

LOCATIONAL RUNNING ANNUAL AVERAGE (LRAA): The average of sample analytical results for samples taken at a particular monitoring location during the previous four calendar quarters.

PARTS PER MILLION (PPM) OR MILLIGRAMS PER LITER (MG/L): One part per million corresponds to one minute in two years or a single penny in \$10,000.


PARTS PER BILLION (PPB) OR MICROGRAMS PER LITER (UG/L): One part per billion corresponds to one minute in 2,000 years, or a single penny in \$10,000,000.

PICOCURIES PER LITER (PCI/L): Picocuries per liter is a measure of the radioactivity in water.


ACTION LEVEL (AL): The concentration of a contaminant which, if exceeded, triggers treatment or other requirements which a water system must follow.

ND: Means not detected and indicates that the substance was not found by laboratory analysis.

N/A: Means not applicable.

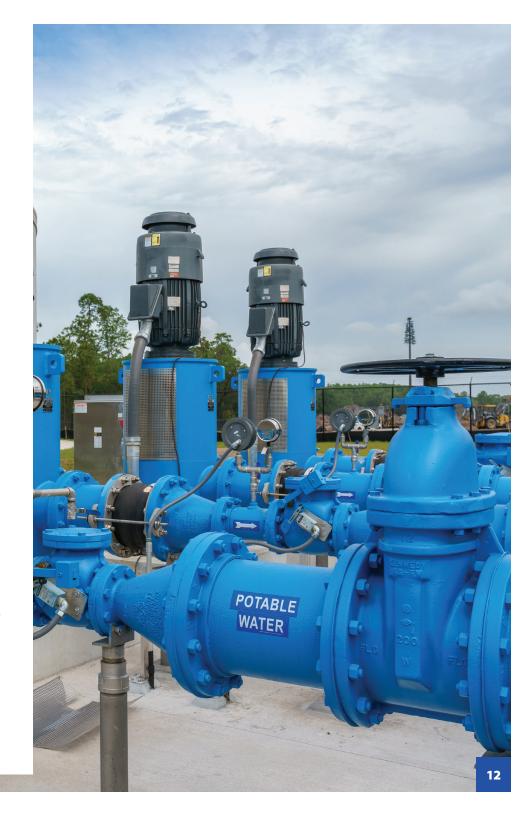

TOHO WATER AUTHORITY SERVICE AREAS

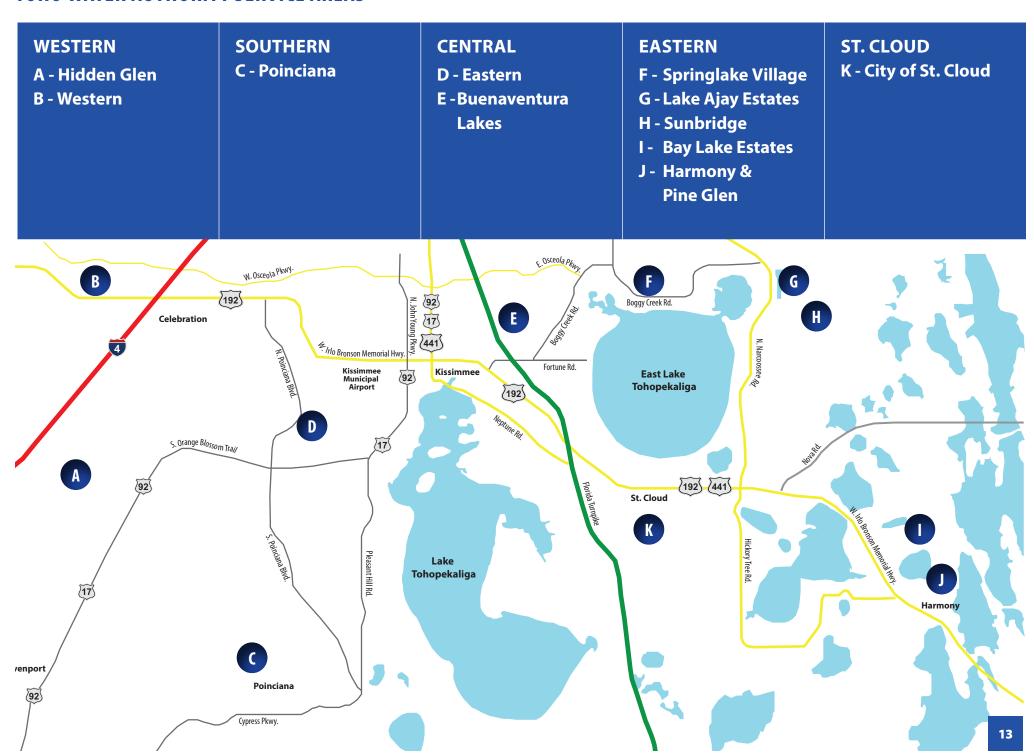

AN EXPLANATION OF THE WATER-QUALITY DATA TABLE

The following tables show the results of our water-quality analyses. Every regulated contaminant that we detected in the water, even in the most minute traces, is listed here. The table contains the name of each substance, the highest level allowed by regulation (MCL), the ideal goals for public health, the amount detected, the usual sources of such contamination, footnotes explaining our findings, and a key to units of measurement.

As authorized and approved by EPA, the State has reduced monitoring requirements for certain contaminants to less often than once per year because the concentrations of these contaminants are not expected to vary significantly from year to year. Some of our data, though representative, is more than one year old.

National Primary Drinking Water Regulation Compliance

Water Quality Data for community water systems throughout the United States is available at www.epa.gov/safewater.



Springlake Village Water System (PWS ID# 349-4418)

INORGANIC CONT	INORGANIC CONTAMINANTS												
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL Violation Y/N	Level Detected	Range of Results	MCLG	MCL	Likely Source of Contamination						
Barium (ppm)	5/21	N	0.013	N/A	2	2	Discharge of drilling wastes; discharge from metal refineries; erosion of natural deposits						
Fluoride (ppm)	5/21	N	0.19	N/A	4	4.0	Erosion of natural deposits; discharge from fertilizer and aluminum factories. Water additive which promotes strong teeth when at the optimum level of 0.7 ppm						
Nitrate (as Nitrogen) (ppm)	2/22	N	0.025	N/A	10	10	Runoff from fertilizer use; leaching from septic tanks, sewage; erosion of natural deposits						
Nitrite (as Nitrogen) (ppm)	2/22	N	0.025	N/A	1	1	Runoff from fertilizer use; leaching from septic tanks, sewage; erosion of natural deposits						
Sodium (ppm)	5/21	N	15.3	N/A	N/A	160	Salt water intrusion, leaching from soil						

SYNTHETIC ORGANIC CONTAMINANTS INCLUDING PESTICIDES AND HERBICIDES											
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL Violation Y/N	Level Detected	Range of Results	MCLG	MCL	Likely Source of Contamination				
Dalapon (ppb)	1/22	N	1.0	0.67 - 1.0	200	200	Runoff from herbicide used on rights of way				

Springlake Village Water System (PWS ID# 349-4418) continued

LEAD AND COPPER (TAP WATER)											
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	AL Exceeded Y/N	90th Percentile Result	No. of sampling sites exceeding the AL	MCLG	AL (Action Level)	Likely Source of Contamination				
Copper (tap water) (ppm)	1/21 - 12/21	N	0.19	0	1.3	1.3	Corrosion of household plumbing systems; erosion of natural deposits; leaching from wood preservatives				
Lead (tap water) (ppb)	1/21 - 12/21	N	0.5	0	0	15	Corrosion of household plumbing systems, erosion of natural deposits				

STAGE 2 DISINFECT	STAGE 2 DISINFECTANTS AND DISINFECTION BY-PRODUCTS											
Disinfectant or Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL or MRDL Violation Y/N	Level Detected	Range of Results	MCLG or MRDLG	MCL or MRDL	Likely Source of Contamination					
Chlorine (ppm)	1/22 - 12/22	N	1.2 (LRAA)	0.7 - 1.4	MRDLG = 4	MRDL = 4.0	Water additive used to control microbes					
Haloacetic Acids (five) [HAA5] (ppb)	1/22 - 12/22	N	37.4 (LRAA)	30.4 - 44.7	N/A	MCL = 60	By-product of drinking water disinfection					
Total Trihalomethanes [TTHM] (ppb)	1/22 - 12/22	Υ	83.87 (Max LRAA)	49.3 - 84.9	N/A	MCL = 80	By-product of drinking water disinfection					

SOURCE WATER ASSESSMENT INFORMATION

In 2022 the Department of Environmental Protection performed a Source Water Assessment on our system. The assessment was conducted to provide information about any potential sources of contamination in the vicinity of our wells. There were no potential sources of contamination near our well. The assessment results are available on the FDEP Source Water Assessment and Protection Program website at www.dep.state.fl.us/swapp.

RADIOACTIVE CONTAMINANTS - CITY OF ST. CLOUD WATER SYSTEM

Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL Violation Y/N	Level Detected	Range of Results	MCLG	MCL	Likely Source of Contamination
Radium-226 (pCi/L)	7/20	N	1.5	0.5 - 1.5	N/A	N/A	Erosion of natural deposits
Gross Alpha (including Uranium)	7/20	N	1.7	ND - 1.7	N/A	N/A	Erosion of natural deposits

INORGANIC CONTAMINANTS - CITY OF ST. CLOUD WATER SYSTEM

Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL Violation Y/N	Level Detected	Range of Results	MCLG	MCL	Likely Source of Contamination
Barium (ppm)	7/20	N	0.0192	0.0137 - 0.0192	2	2	Discharge of drilling wastes; discharge from metal refineries; erosion of natural deposits
Fluoride (ppm)	Monthly 2021	N	0.85	0.43-0.85	4	4.0	Erosion of natural deposits; discharge from fertilizer and aluminum factories. Water additive which promotes strong teeth when at the optimum level of 0.7 ppm
Sodium (ppm)	7/20	N	47.1	25.2 - 47.1	N/A	160	Salt water intrusion, leaching from soil

LEAD AND COPPER (TAP WATER) – CITY OF ST. CLOUD WATER SYSTEM

Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	AL Exceeded Y/N	90th Percentile Result	No. of sampling sites exceeding the AL	MCLG	AL (Action Level)	Likely Source of Contamination
Copper (tap water) (ppm)	8/20	N	1.1	0	1.3	1.3	Corrosion of household plumbing systems; erosion of natural deposits; leaching from wood preservatives
Lead (tap water) (ppb)	08/20	N	0.383	0	0	15	Corrosion of household plumbing systems; erosion of natural deposits

LEAD AND COPPER (TAP WATER) - LAKE AJAY CONSECUTIVE WATER SYSTEM

Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	AL Exceeded Y/N	90th Percentile Result	No. of sampling sites exceeding the AL	MCLG	AL (Action Level)	Likely Source of Contamination
Copper (tap water) (ppm)	09/21	N	0.295	0	1.3	1.3	Corrosion of household plumbing systems; erosion of natural deposits; leaching from wood preservatives
Lead (tap water) (ppb)	09/21	N	0.5	0	0	15	Corrosion of household plumbing systems; erosion of natural deposits

STAGE 2 DISINFECTANTS AND DISINFECTION BY-PRODUCTS – LAKE AJAY CONSECUTIVE WATER SYSTEM

Disinfectant or Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL or MRDL Violation Y/N	Level Detected	Range of Results	MCLG or MRDLG	MCL or MRDL	Likely Source of Contamination
Chlorine Residual (ppm)	1/22 - 12/22	N	1 (LRAA)	0.3 - 1.4	MRDLG = 4	MRDL = 4.0	Water additive used to control microbes
Haloacetic Acids (five) [HAA5] (ppb)	7/22	N	28.8	N/A	N/A	MCL = 60	By-product of drinking water disinfection
Total Trihalomethanes [TTHM] (ppb)	7/22	N	75.1	N/A	N/A	MCL = 80	By-product of drinking water disinfection

SOURCE WATER ASSESSMENT INFORMATION

The City of St. Cloud is supplied with water from groundwater wells that draw from a fresh water reservoir known as the Floridan aquifer. The water from this aquifer is primarily fed by rainwater which is filtered through hundreds of feet of sand and rock in a natural filtering process. Water from the aquifer is pumped from six wells and is treated by a MIEX system and then disinfected with chlorine bleach and fluoridated to enhance dental health. The wells tap into the upper Floridan aquifer and transmit water to one of the City's three treatment facilities.

Please Note: The Department of Environmental Protection performed a Source Water Assessment on our system in 2022. These assessments were conducted to provide information about any potential sources of contamination in the vicinity of our wells. There were four potential sources of contamination identified for this system with low susceptibility levels. Potential sources of contamination identified are petroleum storage tanks. The assessment results are available on the FDEP Source Water Assessment and Protection Program site at www.dep.state.fl.us/swapp.

Sunbridge Water System (PWS ID# 349-4439)

INORGANIC CONT	NORGANIC CONTAMINANTS												
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL Violation Y/N	Level Detected	Range of Results	MCLG	MCL	Likely Source of Contamination						
Barium (ppm)	2/22	N	0.0096	N/A	2	2	Discharge of drilling wastes; discharge from metal refineries; erosion of natural deposits						
Fluoride (ppm)	2/22	N	0.28	N/A	4	4.0	Erosion of natural deposits; discharge from fertilizer and aluminum factories. Water additive which promotes strong teeth when at the optimum level of 0.7 ppm						
Nitrate (as Nitrogen) (ppm)	2/22	N	0.093	0.091 - 0.093	10	10	Runoff from fertilizer use; leaching from septic tanks, sewage; erosion of natural deposits						
Sodium (ppm)	2/22	N	33.7	N/A	N/A	160	Salt water intrusion, leaching from soil						

LEAD AND COPPE	LEAD AND COPPER (TAP WATER)											
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	AL Exceeded Y/N	90th Percentile Result	No. of sampling sites exceeding the AL	MCLG	AL (Action Level)	Likely Source of Contamination					
Copper (tap water) (ppm)	1/22 - 12/22	N	0.12	0	1.3	1.3	Corrosion of household plumbing systems; erosion of natural deposits; leaching from wood preservatives					
Lead (tap water) (ppb)	1/22 - 12/22	N	0.8	0	0	15	Corrosion of household plumbing systems, erosion of natural deposits					

STAGE 2 DISINFECTANTS AND DISINFECTION BY-PRODUCTS

Disinfectant or Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL or MRDL Violation Y/N	Level Detected (LRAA)	Range of Results	MCLG or MRDLG	MCL or MRDL	Likely Source of Contamination
Haloacetic Acids (five) [HAA5] (ppb)	1/22 - 12/22	N	1.8 (LRAA)	0.6 - 2.1	N/A	MCL = 60	By-product of drinking water disinfection
Total Trihalomethanes [TTHM] (ppb)	1/22 - 12/22	N	27.95 (LRAA)	27.3 - 28.6	N/A	MCL = 80	By-product of drinking water disinfection
Chlorine Residual (ppm)	1/22 - 12/22	N	41.4 (LRAA)	41.1 - 41.7	4	4	Water additive to control microbes

SOURCE WATER ASSESSMENT INFORMATION

In 2022 the Department of Environmental Protection performed a Source Water Assessment on our system. The assessment was conducted to provide information about any potential sources of contamination in the vicinity of our wells. There were no potential sources of contamination near our wells. The assessment results are available on the FDEP Source Water Assessment and Protection Program website at www.dep.state.fl.us/swapp.

MONITORING AND REPORTING VIOLATION

We failed to complete required, acceptable quarterly sampling for Synthetic Organic Contaminants Glyphosate and Diquat on time and therefore were in violation of monitoring and reporting requirements. We did collect Glyphosate and Diquat on time, however, DEP could not accept the samples due to the lab results being estimated. Because we did not take the required number of samples, we did not know whether the contaminants were present in your drinking water, and we are unable to tell you whether your health was at risk during that time. The monitoring period was the second quarter of 2022, April 1, 2022 through June 30, 2022. Acceptable sampling resumed during the third quarter, July 1, 2022 through Sept 30, 2022.

Bay Lake Estates Water System (PWS ID# 349-0090)

INORGANIC CONTAMINANTS										
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL Violation Y/N	Level Detected	Range of Results	MCLG	MCL	Likely Source of Contamination			
Barium (ppm)	5/21	N	0.0086	N/A	2	2	Discharge of drilling wastes; discharge from metal refineries; erosion of natural deposits			
Fluoride (ppm)	5/21	N	0.17	N/A	4	4.0	Erosion of natural deposits; discharge from fertilizer and aluminum factories. Water additive which promotes strong teeth when at the optimum level of 0.7 ppm			
Nitrate (as Nitrogen) (ppm)	2/22	N	0.026	0.026	10	10	Runoff from fertilizer use; leaching from septic tanks, sewage; erosion of natural deposits			
Sodium (ppm)	5/21	N	18.8	N/A	N/A	160	Salt water intrusion, leaching from soil			

SYNTHETIC ORGANIC CONTAMINANTS INCLUDING PESTICIDES AND HERBICIDES										
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL Violation Y/N	Level Detected	Range of Results	MCLG	MCL	Likely Source of Contamination			
Hexachlorocyclopentadiene (ppb)	2/21	N	0.034	N/A	50	50	Discharge from chemical factories			

LEAD AND COPPER (TAP WATER)										
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	AL Exceeded Y/N	90th Percentile Result	No. of sampling sites exceeding the AL	MCLG	AL (Action Level)	Likely Source of Contamination			
Copper (tap water) (ppm)	1/21 - 12/21	N	0.422	0	1.3	1.3	Corrosion of household plumbing systems; erosion of natural deposits; leaching from wood preservatives			
Lead (tap water) (ppb)	1/21 - 12/21	N	0.5	0	0	15	Corrosion of household plumbing systems, erosion of natural deposits			

STAGE 2 DISINFECTANTS AND DISINFECTION BY-PRODUCTS Disinfectant or **Dates of** MCL or MRDL Range of MCLG or Contaminant Level sampling MCL or MRDL Violation **Likely Source of Contamination** and Unit of **Detected** Results MRDLG (mo/yr) Y/N Measurement Water additive used to control microbes 1/22 - 12/22 Ν 1.6 (LRAA) MRDLG = 4MRDL = 4.0Chlorine (ppm) 1.1 - 1.7 Haloacetic Acids (five) By-product of drinking water disinfection 1/22 - 12/22 Ν 46.13 (LRAA) 33.7 - 61.2 N/A MCL = 60[HAA5] (ppb) **Total Trihalomethanes** By-product of drinking water disinfection 1/22 - 12/22 Ν 70.45 (LRAA) 62.7 - 88.3 N/A MCL = 80[TTHM] (ppb)

SOURCE WATER ASSESSMENT INFORMATION

In 2022 the Department of Environmental Protection performed a Source Water Assessment on our system. The assessment was conducted to provide information about any potential sources of contamination in the vicinity of our wells. There were no potential sources of contamination near our wells. The assessment results are available on the FDEP Source Water Assessment and Protection Program website at www.dep.state.fl.us/swapp.

Harmony & Pine Glen Water System (PWS ID# 349-4427)

INORGANIC CONTAMINANTS									
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL Violation Y/N	Level Detected	Range of Results	MCLG	MCL	Likely Source of Contamination		
Barium (ppm)	5/21	N	0.012	N/A	2	2	Discharge of drilling wastes; discharge from metal refineries; erosion of natural deposits		
Fluoride (ppm)	5/21	N	0.47	N/A	4	4.0	Erosion of natural deposits; discharge from fertilizer and aluminum factories. Water additive which promotes strong teeth when at the optimum level of 0.7 ppm		
Nitrate (ppm)	2/22	N	0.42	N/A	10	10	Runoff from fertilizer use; leaching from septic tanks, sewage; erosion of natural deposits		
Sodium (ppm)	5/21	N	83.8	N/A	N/A	160	Salt water intrusion, leaching from soil		

STAGE 2 DISINFECTANTS AND DISINFECTION BY-PRODUCTS									
Disinfectant or Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	MCL or MRDL Violation Y/N	Level Detected (LRAA)	Range of Results	MCLG or MRDLG	MCL or MRDL	Likely Source of Contamination		
Chlorine and Chloramines (ppm)	1/22 - 12/22	N	3.4 (LRAA)	1.3 - 3.5	MRDLG = 4	MRDL = 4.0	Water additive used to control microbes		
Haloacetic Acids (five) [HAA5] (ppb)	1/22 - 12/22	N	8.91 (LRAA)	5.4 - 13.5	N/A	MCL = 60	By-product of drinking water disinfection		
Total Trihalomethanes [TTHM] (ppb)	1/22 - 12/22	N	6.25 (LRAA)	2.9 - 10.0	N/A	MCL = 80	By-product of drinking water disinfection		

Harmony & Pine Glen Water System (PWS ID# 349-4427) continued

LEAD AND COPPER (TAP WATER)										
Contaminant and Unit of Measurement	Dates of sampling (mo/yr)	AL Exceeded Y/N	90th Percentile Result	No. of sampling sites exceeding the AL	MCLG	AL (Action Level)	Likely Source of Contamination			
Copper (tap water) (ppm)	3/21	N	0.012	0	1.3	1.3	Corrosion of household plumbing systems; erosion of natural deposits; leaching from wood preservatives			
Lead (tap water) (ppb)	3/21	N	0.5	0	0	15	Corrosion of household plumbing systems, erosion of natural deposits			

SOURCE WATER ASSESSMENT INFORMATION

In 2022 the Department of Environmental Protection performed a Source Water Assessment on our system. The assessment was conducted to provide information about any potential sources of contamination in the vicinity of our wells. There were three potential sources of contamination identified for this system with low susceptibility level, which are the Harmony waste water treatment facility. The assessment results are available on the FDEP Source Water Assessment and Protection Program website at www.dep.state.fl.us/swapp.







951 Martin Luther King Blvd., Kissimmee, FL 34741













